



Mellanox Switch-IB Firmware Release Notes

Rev 11.1910.0618



NOTE:

THIS HARDWARE, SOFTWARE OR TEST SUITE PRODUCT (“PRODUCT(S)”) AND ITS RELATED DOCUMENTATION ARE PROVIDED BY MELLANOX TECHNOLOGIES “AS-IS” WITH ALL FAULTS OF ANY KIND AND SOLELY FOR THE PURPOSE OF AIDING THE CUSTOMER IN TESTING APPLICATIONS THAT USE THE PRODUCTS IN DESIGNATED SOLUTIONS. THE CUSTOMER’S MANUFACTURING TEST ENVIRONMENT HAS NOT MET THE STANDARDS SET BY MELLANOX TECHNOLOGIES TO FULLY QUALIFY THE PRODUCT(S) AND/OR THE SYSTEM USING IT. THEREFORE, MELLANOX TECHNOLOGIES CANNOT AND DOES NOT GUARANTEE OR WARRANT THAT THE PRODUCTS WILL OPERATE WITH THE HIGHEST QUALITY. ANY EXPRESS OR IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT ARE DISCLAIMED. IN NO EVENT SHALL MELLANOX BE LIABLE TO CUSTOMER OR ANY THIRD PARTIES FOR ANY DIRECT, INDIRECT, SPECIAL, EXEMPLARY, OR CONSEQUENTIAL DAMAGES OF ANY KIND (INCLUDING, BUT NOT LIMITED TO, PAYMENT FOR PROCUREMENT OF SUBSTITUTE GOODS OR SERVICES; LOSS OF USE, DATA, OR PROFITS; OR BUSINESS INTERRUPTION) HOWEVER CAUSED AND ON ANY THEORY OF LIABILITY, WHETHER IN CONTRACT, STRICT LIABILITY, OR TORT (INCLUDING NEGLIGENCE OR OTHERWISE) ARISING IN ANY WAY FROM THE USE OF THE PRODUCT(S) AND RELATED DOCUMENTATION EVEN IF ADVISED OF THE POSSIBILITY OF SUCH DAMAGE.



Mellanox Technologies
350 Oakmead Parkway Suite 100
Sunnyvale, CA 94085
U.S.A.
www.mellanox.com
Tel: (408) 970-3400
Fax: (408) 970-3403

© Copyright 2018. Mellanox Technologies Ltd. All Rights Reserved.

Mellanox®, Mellanox logo, Mellanox Open Ethernet®, LinkX®, Mellanox Spectrum®, Mellanox Virtual Modular Switch®, MetroDX®, MetroX®, MLNX-OS®, ONE SWITCH. A WORLD OF OPTIONS®, Open Ethernet logo, Spectrum logo, Switch-IB®, SwitchX®, UFM®, and Virtual Protocol Interconnect® are registered trademarks of Mellanox Technologies, Ltd.

For the complete and most updated list of Mellanox trademarks, visit <http://www.mellanox.com/page/trademarks>.

All other trademarks are property of their respective owners.



Table of Contents

Chapter 1 Overview	3
1.1 Supported Systems.....	3
1.2 Firmware Interoperability	3
1.3 Supported Cables and Modules	3
1.4 Firmware Upgrade	4
1.5 PRM Revision Compatibility.....	4
Chapter 2 Changes and New Features in Rev 11.1910.0618	5
Chapter 3 Known Issues	6
Chapter 4 Bug Fixes History	8
Chapter 5 Firmware Changes and New Feature History	11



List of Tables

Table 1:	Release Update History	2
Table 2:	Supported Systems	3
Table 3:	Firmware Interoperability	3
Table 4:	Firmware Rev 11.1910.0618 Changes and New Features	5
Table 5:	Known Issues	6
Table 6:	Fixed Bugs List	8
Table 7:	History of Major Changes and New Features	11



Release Update History

Table 1 - Release Update History

Date	Description
December 05, 2018	Initial release of this firmware version.

1 Overview

These are the release notes for the Switch-IB™ firmware, Rev 11.1910.0618. This firmware complements the Switch-IB™ silicon architecture with a set of advanced features, allowing easy and remote management of the switch.

1.1 Supported Systems

This firmware supports the devices and protocols listed in Table 2. For the most updated list of switches supported, visit the Firmware Download pages on Mellanox.com.

Table 2 - Supported Systems

Device Part Number	Description
MSB7790	Switch-IB™ based EDR InfiniBand switch; 36 QSFP28 ports; externally managed

1.2 Firmware Interoperability

This FW version has been validated to work against platforms with the following SW versions.

Table 3 - Firmware Interoperability

HCA/Switch	Firmware Version
Switch-IB™ 2	15.1910.0618
SwitchX®-2	9.4.2000
ConnectX®-5 (Ex)	16.24.1000
ConnectX-4 Lx	14.24.1000
ConnectX-4	12.24.1000
Connect-IB®	10.16.1200
ConnectX-3 (Pro)	2.42.5000
MFT	4.11.0

1.3 Supported Cables and Modules

For a list of the Mellanox supported cables please visit the LinkX™ Cables and Transceivers page of the Mellanox Website at:

<http://www.mellanox.com/products/interconnect/cables-configurator.php>



When using Mellanox AOC cables longer than 50m use one VL to achieve full wire speed.

Please refer to the LinkX™ Cables and Transceivers webpage for the full list of supported cables and transceivers <http://www.mellanox.com/products/interconnect/cables-configurator.php>

1.4 Firmware Upgrade

Firmware upgrade may be performed directly from any previous version to this version. To upgrade firmware, please refer to the Mellanox Firmware Tools (MFT) package at:

http://www.mellanox.com/page/management_tools

1.5 PRM Revision Compatibility

Firmware Rev 11.1910.0618 complies with the *Mellanox Switches Programmer's Reference Manual (PRM)*, Rev 1.45 or later.

2 Changes and New Features in Rev 11.1910.0618

Table 4 - Firmware Rev 11.1910.0618 Changes and New Features

Category	Description
General	Added support for PortStateTable standard SMP MAD
Chassis Management	Added support for PSU utilization and consumption of output power monitoring
Chassis Management	Added support for PSU temperature and 12V Vout monitoring

3 Known Issues

Table 5 describes known issues in this firmware release and possible workarounds.

Table 5 - Known Issues

Internal Ref.	Issue
955641	Description: VL_HIGH_LIMIT is not affecting the VL arbiter as expected.
	Workaround: Arbitration table should be set using the low priority VL arbitration table only.
	Keywords: VL Arbitration
1249608	Description: Configuring weight “0” for VL, results in unexpected behavior.
	Workaround: Arbitration table should be configured with weights other than “0”.
	Keywords: VL Arbitration
982005	Description: When connecting 6 & 7 meters, link may raise DDR instead of QDR against GD4000/IS5000 switches.
	Workaround: N/A
	Keywords: Link
-	Description: Congestion control 1.3 supports congestion log only.
	Workaround: N/A
	Keywords: QoS
-	Description: Port LEDs do not flash on system boot.
	Workaround: N/A
	Keywords: LEDs
-	Description: Link width reduction is not supported in this release.
	Workaround: N/A
	Keywords: Power Management
-	Description: If QDR is not enabled for the switch’s InfiniBand Port Speed while connected to ConnectX-3/Pro or Connect-IB® FDR adapters or to SwitchX® /SwitchX®-2 FDR switches, links will rise at SDR or DDR (even if FDR is enabled)
	Workaround: Enable QDR (in addition to FDR) when connecting to peer ports running at FDR
	Keywords: Interoperability
-	Description: Force FDR10 is not supported on EDR products.
	Workaround: To raise link with an FDR10 device, make sure all speeds, including EDR, are configured on Switch-IB.
	Keywords: Interoperability

Table 5 - Known Issues

Internal Ref.	Issue
-	Description: Fallback Routing is not supported for DF+ topology. Fallback Routing Notifications and Adaptive Routing notifications are not supported for topologies others then trees.
	Workaround: N/A
	Keywords: Network
697149	Description: Link rises at DDR speed instead of FDR10 when using 100m QDR/FDR10 optical cables.
	Workaround: N/A
	Keywords: Link
-	Description: FDR link may rise with symbol errors on optic EDR cable longer than 30M.
	Workaround: N/A
	Keywords: Link
-	Description: Fan LEDs may behave unexpectedly in the first 5 seconds of system boot.
	Workaround: N/A
	Keywords: LEDs
-	Description: Module info page in Diagnostics Data VS-MAD is not supported
	Workaround: N/A
	Keywords: Diagnostics Data VS-MAD

4 Bug Fixes History

Table 6 - Fixed Bugs List

Internal Ref.	Issue
1337469	Description: in rare cases, when a receiver's electrical eye is narrow, link might raise with BER higher (worse) than 10^{-12} .
	Keywords: Link
	Discovered in Release: 11.1500.0034
	Fixed in Release: 11.1630.0206
1092005	Description: Enable SDR speed regardless of cable supported speeds
	Keywords: Link
	Discovered in Release: 11.1400.0102
	Fixed in Release: 11.1500.0106
-	Description: VL arbitration does not distribute traffic as expected in case of multiple VLs.
	Keywords: General
	Discovered in Release: 11.1200.0102
	Fixed in Release: 11.1300.0100
-	Description: In rare cases, FDR links may rise with errors. (Improved BER performance.)
	Keywords: Link
	Discovered in Release: 11.1.1002
	Fixed in Release: 11.1200.0102
-	Description: Insertion of QDR cables into a Switch-IB™ based switch overwrites non-volatile fields (rx_output_amp/emp).
	Keywords: System Management
	Discovered in Release: 11.1100.0072
	Fixed in Release: 11.1200.0102
-	Description: Bubbles appear as symbol errors when link raises FDR 1x.
	Keywords: Link
	Discovered in Release: 11.1.1002
	Fixed in Release: 11.1200.0102
-	Description: PSU fans set to work with 60% max speed by default.
	Keywords: Chassis Management
	Discovered in Release: 11.0350.0394
	Fixed in Release: 11.1100.0072

Table 6 - Fixed Bugs List

Internal Ref.	Issue
-	Description: The command “show interfaces ib * transceiver” shows no cable is connected while link is up.
	Keywords: Chassis Management
	Discovered in Release: 11.0350.0394
	Fixed in Release: 11.1100.0072
690231	Description: Fixed MSGI data reading.
	Keywords: General
	Discovered in Release: 11.1.1002
	Fixed in Release: 11.0350.0394
-	Description: In rare cases, link may degrade speed from EDR or FDR to a lower speed. In other cases physical errors may increment.
	Keywords: Link
	Discovered in Release: 11.0350.0372
	Fixed in Release: 11.0350.0394
-	Description: Minimum fan speed may drop.
	Keywords: Temperature
	Discovered in Release: 11.0200.0120
	Fixed in Release: 11.0204.0124
-	Description: Bit error rate is not optimal on QDR links.
	Keywords: Link
	Discovered in Release: 11.1.1002
	Fixed in Release: 11.0200.0118
-	Description: Only connections to Switch-IB™, ConnectX®-3, ConnectX-3 Pro, Connect-IB™, and SwitchX® family devices are supported.
	Keywords: Interoperability
	Discovered in Release: 11.1.1002
	Fixed in Release: 11.0100.0112
-	Description: Connecting a cable longer than 30m to ConnectX-3, ConnectX-3 Pro or Connect-IB plat- forms causes interoperability issues.
	Keywords: Interoperability
	Discovered in Release: 11.1.1002
	Fixed in Release: 11.0100.0112

Table 6 - Fixed Bugs List

Internal Ref.	Issue
-	Description: Packets are lost on private linear forwarding table (pLFT).
	Keywords: pLFT
	Discovered in Release: 11.1.1002
	Fixed in Release: 11.0100.0112
-	Description: Port LEDs may continue to blink even after a bad cable is removed.
	Keywords: Chassis Management
	Discovered in Release: 11.1.1002
	Fixed in Release: 11.0100.0112

5 Firmware Changes and New Feature History

Table 7 - History of Major Changes and New Features

Category	Description
11.1701.0010	
General	Added support for congestion control log 1.3 as described in IBTA IB specification release 1.3, Annex A10
General	Added additional information (PDDR pages as described in the <i>Switches PRM</i> , section 8.15.50 PDDR - Port Diagnostics Database Register) to diagnostics data VS-MAD as described in Mellanox Vendor Specific MAD Specification 1.4 section 3.33 – Diagnostic-Data
Chassis Management	Added ability to read part numbers and serial numbers for fans (by using MFNR register) and the power supply (by using MSPS register)
11.1630.0206	
General	Bug fixes
11.1610.0196	
General	Added additional information (PDDR pages as described in the <i>Switches PRM</i> , section 8.15.50 PDDR - Port Diagnostics Database Register) to diagnostics data VS-MAD as described in Mellanox Vendor Specific MAD Specification 1.4 section 3.33 – Diagnostic-Data
General	Added support for congestion control log 1.3 as described in IBTA IB specification release 1.3, Annex A10
11.1500.0106	
General	Added support for IB telemetry, Top Talkers. See “Congestion Telemetry” section in Mellanox Switches PRM (Programmer's Reference Manual).
Modules	Added support for 100GbE PSM4/LR4 modules.
11.1430.0160	
General	Added support for Adaptive Routine (AR) optimizations with ConnectX-5 (RC Mode)
Link	Added support for Force EDR on Switch IB systems As described in Mellanox Switches Programmer's Reference Manual (PRM) under PTYS Register
11.1400.0102	
General	Added support for IB telemetry, Congestion Monitoring-Thresholds (See Mellanox Switches PRM (Programmer's Reference Manual) - section 9.7 - Congestion Telemetry).
General	Added support for Additional Port Counters Extended (See IB Specification Vol 1-Release-1.3, MgtWG 1.3 Errata).
General	Added support for IB Router Port (Port 37) Counters (See IB Specification Vol 1-Release-1.3)
11.1300.0126	

Table 7 - History of Major Changes and New Features

Category	Description
General	Added support for burst/traffic histograms (described in Vendor Specific MAD PRM Rev 1.3, Section 3.33 – Mellanox Performance Histograms)
Link	Added support for Port PHY Link Mode (PLLM) register (For register description, See Switch PRM - PPLM - Port Phy Link Mode)
Link	Added support for QSFP copper cables which do not publish attenuation in the memory map